Wor	·k O	rder	ID	63393
-----	------	------	----	-------

Thursday, October 28, 2010 12:24:38 PM



Page 1

marsaay, Octob	C 20, 2010 12	.24.30 1 1/1									
Item ID: Revision ID:	D212-664-101	TRN		Accept				S	Setup St		
Item Name:	Crosstube Turnin	ng Detail							St	ор 📗	
Start Date: Required Date: Reference:		Start Qty: 1.00 Req'd Qty: 1.00	1 (88) 11 (18) 18 (18) 1 (18) 16 (18)	ç	Cust Item I Customer:	D:					
Approvals:	Process Plan:	W	Date: 10-10-2	Tooling:	D:	ate:	_	F	Run St	art	
	QC:	/	Date:	SPC (Y/N):		ate:			St	top	
Sequence ID/ Work Center II		Operation Description		Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revisi	ion Nbr						-			
D212-664-141	Rev D										
	1	MORI SEIKI CNC LA	THE LARGE	0.00							
Mori Seiki		Memo		0.00				<del></del>	-		
Mori Seiki CNC Lat	he Large	2-Turn firs	with sand & install plugs E st side as per Folio FA113 on transition lines smooth.	OT8534 on both ends as p	er Folio FA113	- 10/11/0	2				
110	(	QC1- Inspect dimensio	ns to dimension sheet	0.00	, 1						
QC Quality Control		Мето		0.00	) h 10/11/02	2					
120 Hibba Haid Haid Haid 1011 1011	3	MORI SEIKI CNC LA	THE LARGE	0.00							
Mori Seiki	'			0.00	, 1			/			
Mori Seiki CNC Lat	the Large	2-File dov	cond side as per Folio FA11 vn transition lines smooth. e sand and plugs	*	1/11/02						# 1

4

Dart Aerospace L	Ltd
------------------	-----

W/O:			V	ORK ORDER CH	HANGES		ı			
DATE	STEP	PRO	CEDURE CH	ANGE		Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
					· · · · · · · · · · · · · · · · · · ·		1	-		
							1		II	
							1			
					* \$4. <b>9</b> -		.,			
					74	.*	4			
							1			
Part No	:	PAR #:	Fault Ca	tegory:	NC	R: Yes	No <b>DQ</b>	A:	_ Date: _	
	R	esolution:	Disposit	ion:	QA	: N/C C	losed:		Date: _	
NCR:		\	WORK OR	DER NON-CONF	ORMANCE	(NCI	₹)			
DATE	STEP	Description of NC		Corrective Action	Section B	0:	Verific	cation	Approval	Approval
DAIL	SILI	Section A	Initial Chief Eng	Action Descr Chief Eng		Sign Date		on C	Chief Eng	QC Inspector
									1	
										:
	<u> </u>			- <del>1</del> -1			4			
							1			
							(			
									•	
,						4		!		
			i			'				

**Required Date:** 11/11/2010

Thursday, October 28, 2010 12:24:38 PM

Item ID:

D212-664-101TRN

Accept



Setup Start

Stop



**Revision ID:** 

Item Name:

Crosstube Turning Detail

**Start Date:** 

10/28/2010

Start Otv: 1.00

Req'd Qty: 1.00



**Cust Item ID: Customer:** 

Reference:

Approvals:	
------------	--

QC:

Process Plan:

\_\_\_\_\_ Date:\_\_\_\_

Date:\_\_\_\_

Tooling:

SPC (Y/N):

Date: Date:

Stop



Sequence ID/ **Work Center ID** 

130

Quality Control

Operation Description

QC1- Inspect dimensions to dimension sheet

Memo

Set Up/ **Run Hours** 

0.00 10/11/02

0.00

Tool ID

Tool # Plan Accept Code

Qty

Run

Reject Qty

Reject Insp. Number Stamp

140

QC

QC8- Inspect parts - second check

Memo

0.00

0.00

andiolilo2

Quality Control

150

HandFXtube

Hand Finishing Crosstubes

Crosstubes Chemical Conversion

Memo

0.00

0.00

5H) 11-03

	•									<b>t</b> .
W/O:			W	ORK ORDER CHANG	GES	*	1			
DATE	STEP	PRO	OCEDURE CHA	NGE	E	Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
						(				
						1				
. §'						1				
						1				
Part No	); 	PAR #:	Fault Cate	gory:	NCR:	Yes N	lo <b>DQ</b>	A:	Date:	
	Re	esolution:	Disposition	n:	QA: N	/C Clo	sed:		Date:	<u>.</u>
NCR:		,	WORK ORD	ER NON-CONFORM	IANCE (	NCR)				
DATE	STEP	Description of NC			ction B		Verific	cation	Approval	Approval
DAIL	JILF	Section A	Initial Chief Eng	Action Description Chief Eng		ign & Date		on C	Chief Eng	QC Inspector
						1				
						1				
						,				
						**				
						i				
		•				1	,			
						1		:		
						4				

#### Work Order ID 63393

Thursday, October 28, 2010 12:24:38 PM



Page 3

Item ID:

D212-664-101TRN

Accept



Setup Start



**Revision ID:** 

Item Name:

Crosstube Turning Detail

**Start Date:** 

**Required Date:** 11/11/2010

10/28/2010

Start Qty: 1.00

**Reg'd Oty:** 1.00



Date: \_\_\_\_\_

Cust Item ID:

**Customer:** 

Reference:

Approvals:

Sequence ID/

Work Center ID

Process Plan: \_\_\_\_

Operation

Description

Date:

Tooling:

SPC (Y/N):

Set Up/

Date:

Date:

Run

Start

Stop

Stop

QC3- Inspect Part Finish

Run Hours 0.00

Tool ID

Tool # Plan Code

Accept Qty

Reject Otv

Reject Insp. Number Stamp

160

Quality Control

Memo

0.00

170

Packaging Packaging

Packaging

Memo

Identify and Stock in kanban rack

0.00

0.00

Location: LG

QC21- Final Inspection - Work Order Release

180

Quality Control

QC

Memo

0.00

0.00

Dart Ae	ospace	ELIC							•
W/O:			WO	RK ORDER CHANG	ES	f	··· -		
DATE	STEP	PRO	OCEDURE CHAI	NGE	Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
						1			
	· .					ļ.			
			· · · · · · · · · · · · · · · · · · ·			i			
						4			
Part No	:	PAR #:	Fault Cate	gory:	_ NCR: Yes	s No <b>DQ</b>	A:	_ Date: _	
	R	lesolution:	Disposition	);	_ QA: N/C	Closed:		Date: _	
NCR:			WORK ORDE	R NON-CONFORMA	NCE (NC	R)			
		Description of NC		Corrective Action Secti	on B	Vorifi	cation	Ammuoval	Annuoval
DATE	STEP	Section A	Initial Chief Eng	Action Description Chief Eng	Sigr Dat	N& Sect	ion C	Approval Chief Eng	Approval QC Inspector
						1			
		·				1			
						ı			
						ı			
								,	
								····	

### **Picklist Print**

Thursday, October 28, 2010 12:24:42 PM

Work Order ID: 63393

Parent Item:

D212-664-101TRN

Parent Item Name: Crosstube Turning Detail





Start Date: 10/28/2010

**Required Date:** 11/11/2010

Page 1

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:A 08-03-06 new issue DD verified by:ec

IPP Rev B 08.04.02 removed Polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6005-128	<b>110</b> (100) (0)( (00)	Manufactured	No			120	Each	39.0000	1	1	, 1	1	
										)I	10/11/	74	

Crosstube Material

Locati	<u>ion</u>	Loc Oty	Loc Code
LG	•	.39	
*	53593	5	•
	57911	34	

Dart Ae	rospace	Ltd					1			,
W/O:			V	ORK ORDER CHAN	IGES					
DATE	STEP	PRO	OCEDURE CH	IANGE		Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
							1			
						,	4			·
					·					
		,					l			
					•			}		
Part No	):	PAR #:	Fault Ca	tegory:	NCF	R: Yes N	lo <b>DQ</b>	A:	_ Date: _	
	R	esolution:	Disposit	ion:	QA:	N/C Clo	sed:		Date:	
NCR:		•	WORK OR	DER NON-CONFOR	MANCE	(NCR)				V - 1
DATE	STEP	Description of NC			Section B		Verific	cation	Approval	Approvai
DAIL	SIEP	Section A	Initial Chief Eng	Action Descriptio Chief Eng	n	Sign & Date		on C	Chief Eng	QC Inspector
						1			,	
					ŀ					
					<del></del>	ı	-			
						1				
	t .	1			Ì	1				I

DART AEROSPACE LTD	Work Order:	43393
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number:	D212-664-141
Inspection Dwg: D212-664-141 Rev: D		Page 1 of 1

## FIRST ARTICLE INSPECTION CHECKLIST

X First Article Prototype

_							
	spection Sheet wing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
	0.200	+/-0.010	-2/0			Wern 11-3	
	R0.063	+/-0.010	.063			R-G	
	2.740	+0.005/-0.000	2.740			mic cuc-04	
	5.097	+/-0.030	5.100	/		Vern 21-3	
	2.304	+0.005/-0.000	2.305				
	2.340	+0.005/-0.000	2.341			^	
EA	2.398	+0.005/-0.000	2.400	//		~	
SIDE	2.448	+0.005/-0.000	2450	/4		. ~	
0,	2.498	+0.005/-0.000	2.500			~	
	2.549	+0.005/-0.000	2551			~	
	2.599	+0.005/-0.000	2-604			~	
	2.671	+0.005/-0.000	2.674			~	
	2.701	+0.005/-0.000	2,705			~	
	0.200	+/-0.010	.210	/		vern JL3	
,	R0.063	+/-0.010	-063			R-47	
	2.740	+0.005/-0.000	2-743	//		mic cuc-oy	
	5.097	+/-0.030	5.110	/		Vern JL-3 ~	
	2.304	+0.005/-0.000	2307				
_ [	2.340	+0.005/-0.000	2-344			~	
E B	2.398	+0.005/-0.000	2.403	//		٦	
SIDE	2.448	+0.005/-0.000	2.452	/		~	·
	2.498	+0.005/-0.000	2.503,	//		۸.	
	2.549	+0.005/-0.000	2.554			~	
	2.599	+0.005/-0.000	2604			~	
	2.671	+0.005/-0.000	2.676			-	
	2.701	+0.005/-0.000	2.706	/	·		·.
·	126.514	+/-0.020	126.530			m-tape	

Measured by:	Audited by:	Jul	Prototype Approval:	N/A
Date: /0///02	Date:	10/11/02	Date:	N/A

KJ/JLM	
KJ/JLM	
KJ/JLM (A	1
KJ 💖	<u> </u>
-	KJ/JLM (A

W/O:		WORK ORDE	·				
DATE	STEP	PROCEDURE CHANGE	Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
				×		,	e e
							,
		1					
		F			•		

Part No: _		PAR #:	Fault Category:	NCR: Yes No DQA:	Date:
	Resolution:	L.	Disposition:	QA: N/C Closed:	Date:
NCR:		WC	ORK ORDER NON-CONFORMA	NCE (NCR)	and the second s

NCR:		WOTH OTBETT HON-OOM OTHMANOE (HON)											
		Description of NC	Corrective Action Section B					Corrective Action Section B			Verification	Approval	Approval
DATE	STEP	Section A	Initial . Chief Eng	Action Description Chief Eng	Sign & Date	Section C	Chief Eng	QC inspector					
		0	ļ	4.									
		1					``	i					
		ŧ					قر						
		1											
		ı											
				•.		,							
		1											
		,											

Item	Qty -141	Qty -141B	Part Number	Description
1	x		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		Х	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

#### **GENERAL NOTES:**

1) MATERIAL: MANUFACTURED FROM D6005-128 FINISHED LENGTH = 126.514±0.020


2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2 PAINT OUTSIDE PER DART QSI 005 4.2

- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
- D212-664-1418 = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY, CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


**SHOP COPY RETURN TO ENGINEERING UNCONTROLLED COPY** SUBJECT TO AMENDMENT WITHOUT NOTICE

D			ENERAL NOTES/PART LIST; AND REFORMATTED DRAWING	RF	09.09.30	
		RENT STANDA				
			TOLERANCES (ZN B4-3, C6-3, C8-3)			
1			FLAG #6 PER PAR 08-046 (ZN A5-3):		l i	
			AIL & UPDATED TOLERANCE TO		1	
	SHEET	4 .			ļ .	
C REMOVE -851 ABRASIO			SION STRIP; ADD MAGNOBOND	PH	07.03.08	
	6398, C	USHION, REV	ERSE CLAMPS	FFI	07.03.06	
В			MPATABILITY WITH BHT/AA	PH	05.02.04	
	SKIDTL	JBES		05.02.04		
Α	NEW IS	SUE	PH	00.12.12		
REV.			BY	DATE		
DESIGN		PH	DART AEROSP	ACE	LTD	
DRAWN	•	RF	HAWKESBURY, ONTAR			
CHECK	D	qo .	DRAWING NO. RE			
MFG. AF	PPR.	7	D212-664-141	5	SHEET 1 OF 4	
APPRO	√ED	10	TITLE		SCALE	
DE APP	R.		XTUBE ASS'Y (205/212/412	HI FWI	D) NTS	
DATE	09.0	9.30	COPYRIGHT © 2000 BY DART AI THE COCUMENT IS PRIVATE AND COMPDENTIAL AND IS SUPPLIES NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNIC	ON THE EXPRE	35 CONDITION THAT IT IS	

W/O:		WORK ORDER CHANGES									
DATE	STEP	PR	OCEDURE CHAN	NGE	Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector		
						1					
						(					
						4					
						1					
						1					
						:					
Part No	•	PAR #:	Fault Categ	jory:	NCR: Yes	No DQ	<b>\</b> :	_ Date: _			
	Resc	olution:	Disposition	QA: N/C CI	osed:		Date: _				
NCR:		,	WORK ORDE	R NON-CONFORMA	NCE (NCF	R)					
DATE	STEP	Description of NC		Corrective Action Section		Verific	ation	Approval	Approval		
DATE	SIEF	Section A	Initial Chief Eng	Action Description Chief Eng	Sign 8 Date	k Section		Chief Eng	QC Inspector		
						i					
						1					
· · · · · · · · · · · · · · · · · · ·											
						1					
						'					
, •					4						
			1		ı	1			1		

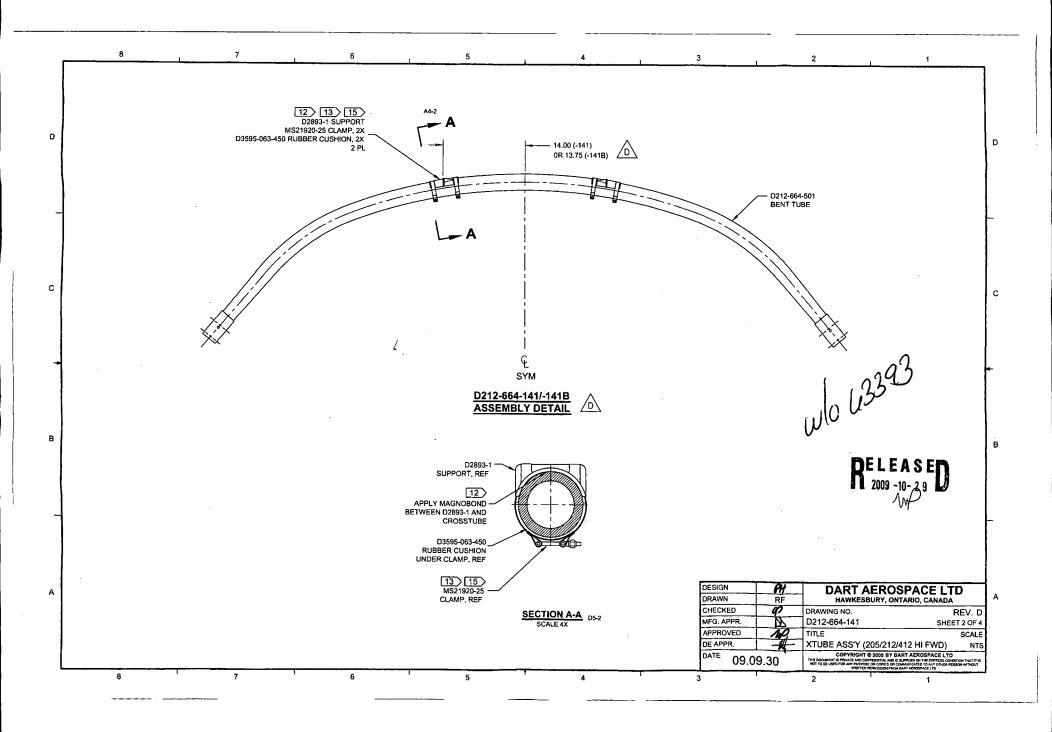


DATE STEP PROCEDURE CHANGE By Date Qty Chief Eng / Prod Mgr	Approval QC Inspector
Part No: PAR #: Fault Category: NCR: Yes No DQA: Date:	
Resolution: Disposition: QA: N/C Closed: Date:	
NCR: WORK ORDER NON-CONFORMANCE (NCR)	-
DATE STED Description of NC Corrective Action Section B Verification Approval	Approval
DATE STEP Description of NC Section A Section A Section C Section	QC Inspector

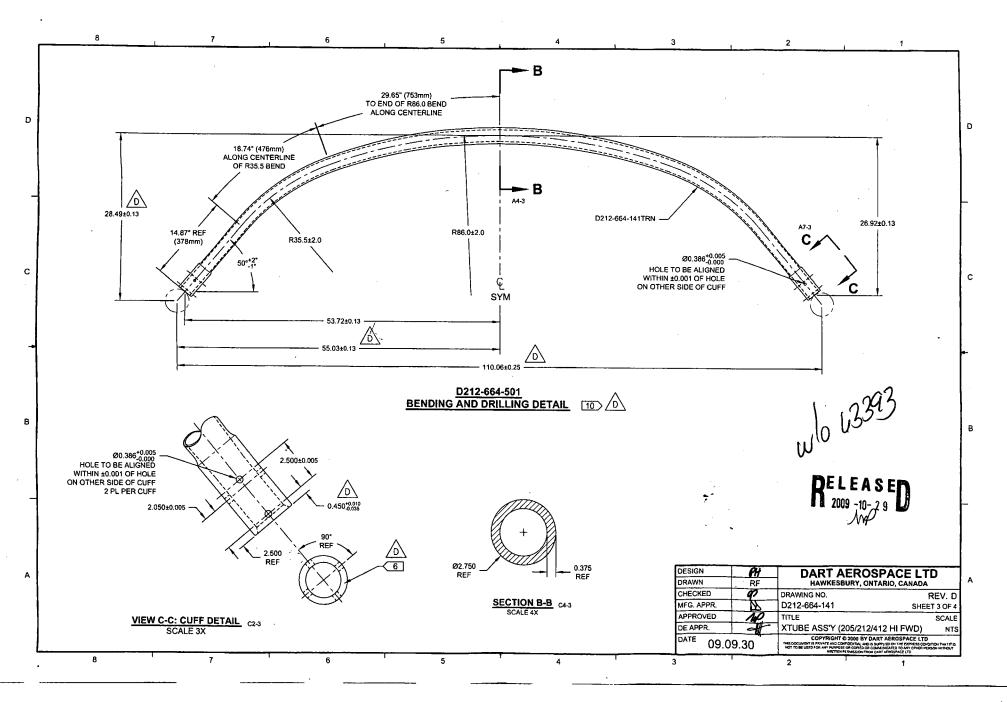

Dart Aerospace Lt
-------------------

	Johaco						1			•
W/O:			WO	RK ORDER CHANG	ES					
DATE	STEP	PROCEDURE CHANGE				Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
						į				
							•			
							4			
,							# # 1			
Part No:		PAR #:	Fault Cate	gory:	_ NCR:	Yes N	o <b>DQ</b>	<b>4</b> :	Date:	
Resolution:			Disposition: QA: N/C			I/C Clos	sed:		Date: _	
NCR:		,	WORK ORDE	R NON-CONFORMA	NCE (	NCR)				
		Description of NC	Corrective Action		Section B		Verificatio		Approval	Approval
DATE	STEP	Section A	Initial Chief Eng	Action Description Chief Eng		Sign & Date	Secti		Chief Eng	QC Inspector
						1				
						1				

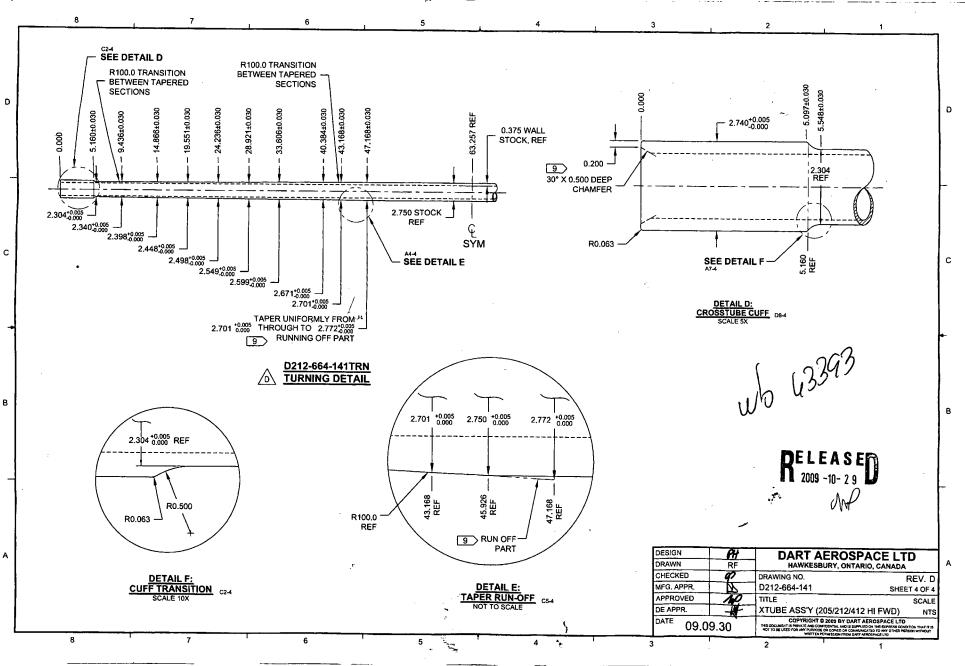

W/O:		WORK ORDER CHANGES	WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	Ву	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
				1				
							~	
	1			1				
	,			1			·-·	
		·						
Part No	):	PAR #: Pault Category: NC	R: Yes	No <b>DQ</b>	A:	Date: _		

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_ Date: \_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)								
DATE		Description of NC Section A	Corrective Action Section B				Verification	Ammenuel	Annroyel	
	STEP		Initial Chief Eng	Action Descr Chief Eng	iption	Sign & Date	Section C	Approval Chief Eng	Approval QC Inspector	
						l i	·	*	-	
						i		li		
· · · · · · · · · · · · · · · · · · ·		·								
					,	1	·			
		٧.								
			-						,	
4					i.					
					780; **	4	• ,			